



Dart Hawkesbury
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D212-664-101
Job Sheet 167129-B



Part No: D212-664-101

Job Qty: 1 ea

Part Name: Fwd Crosstube - High



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 10/25/17

Job Tracking No:

Due Date: 11/10/17

Created By: Victoria Michaud-Febrille

Type: Stock

Description:

Customer: Ascent Helicopters Ltd (CASCE01)

1550 Springhill Road Parksville, BC, V9P 2Y2 Canada ph:(250) 752-2981 fx:(250) 752-2983.

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier	
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time
90	Start up Operation	1 Ea		11/9/17	0.00	0.00	Start Up Crosstubes	DP2
110	Packaging	1 pcs		11/9/17	0.00	0.00	Packaging1	DP2
120	CNC Bend Crosstubes	1 pcs		11/9/17	3.11	2.22	CNC Bend Crosstube	GP2DP2
130	QC	1 pcs		11/9/17	0.00	0.00	QC15	DP2
140	Crosstubes	1 pcs		11/9/17	0.00	0.67	Crosstube	GP1DP2
150	HandFXtube	1 pcs		11/9/17	0.00	0.98	HandFinish5	DP2
160	QC	1 pcs		11/9/17	0.00	0.00	QC7	AK 17-12-20
165	QC	1 pcs		11/9/17	0.00	0.00	QC5	AK 17-12-20
170	Outsource	1 pcs		11/9/17			SKY002-VC	CX17/12/21
180	Packaging	1 pcs		11/9/17	0.00	0.00	Packaging2	AK 17-12-22
190	QC	1 pcs		11/9/17	0.00	0.00	QC5	AK DEC 22 2017
200	SprayPaint	1 pcs		11/9/17	0.00	0.25	Spray Paint	AK DEC 22 2017
210	QC	1 pcs		11/9/17	0.00	0.00	QC14	AK DEC 22 2017
220	Crosstubes	1 pcs		11/10/17	0.00	1.69	Crosstube	AK 17-12-23
230	QC	1 pcs		11/10/17	0.00	0.00	QC5	38
240	Packaging	1 pcs		11/10/17	0.00	0.00	Packaging1	9-80
250	QC	1 pcs		11/10/17	0.00	0.00	QC4	AK
255	DC	1 pcs		11/10/17	0.00	0.00	DC	AK
260	Packaging	1 pcs		11/10/17	0.00	0.00	Packaging3	AK
270	QC21-FG	1 Ea		11/10/17	0.00	0.00	QC21	AK

Part Op 120 - Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101

Descriptions: 140 - "1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10 2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes. 3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141 4-*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141"

150 - ***IMMEDIATELY AFTER GRINDING***

170 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order

180 - Ensure copy of NDT results attached to work order.

190 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Inspect for damage & ensure results are as per Dwg D212-664-141

200 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** 1-Prime inside & outside crosstube as per QSI 005 4.2 BATCH: 2- After painting remove masking and apply matte clear coat per QSI005 4.2 3- MASK

Prime 138646 Clear P.O. 38687 Paint 138669

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____ Date : _____	DISPOSITION Rework ☐ Scrap ☐ Re-work ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:15%;">Skid-tube ☐</td> <td style="width:15%;">Cross tube ☐</td> <td style="width:15%;">Water Jet ☐</td> <td style="width:15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																		
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																			
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																			
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																			
Large Fab ☐	Composite ☐	Supplier ☐																																																																				
		QTY Effective : _____		MRB (QS1042) Approval																																																																		
Description Job No: 167129-B Mfg Date: 12/18/17		Disposition Start up operation D212-664-101																																																																				
		Completed By _____																																																																				
		Lead hand / Supervisor Approval Verification _____																																																																				
		QC / QA Coordinator Approval _____																																																																				
DART Aerospace Ltd. 1270 Aberdeen Street Hawkesbury, ON K6A 1K7 TEL: 1 613 632-5200 Email: sales@dartaero.com www.dartaerospace.com PART NO: S024159 Revision: 1 Operation: Fwd cross tube - High Change No: D212-664-101																																																																						
<table style="width:100%; border: none;"> <tr> <td colspan="2" style="width:25%;">Root Cause</td> <td style="width:25%;"></td> <td style="width:25%;"></td> <td style="width:25%;"></td> </tr> <tr> <td style="width:12.5%;">Environment ☐</td> <td style="width:12.5%;">No Re-verification ☐</td> <td style="width:12.5%;"></td> <td style="width:12.5%;"></td> <td style="width:12.5%;"></td> </tr> <tr> <td>Design ☐</td> <td>Operator ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Doc/Data ☐</td> <td>Offset/Setup ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Equip/Tooling ☐</td> <td>Supplier ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Handling/Pre ☐</td> <td>Training ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Material ☐</td> <td>Use for Testing ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Internal Transport ☐</td> <td>Poor Information ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Tribal Knowledge ☐</td> <td>Rushing ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>LOA ☐</td> <td>Product Improvement ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Substation ☐</td> <td>Process Improvement ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Past Expiry Date ☐</td> <td>Manufacturing Process ☐</td> <td></td> <td></td> <td></td> </tr> <tr> <td>Misidentified ☐</td> <td>Past Due ☐</td> <td></td> <td></td> <td></td> </tr> </table>						Root Cause					Environment ☐	No Re-verification ☐				Design ☐	Operator ☐				Doc/Data ☐	Offset/Setup ☐				Equip/Tooling ☐	Supplier ☐				Handling/Pre ☐	Training ☐				Material ☐	Use for Testing ☐				Internal Transport ☐	Poor Information ☐				Tribal Knowledge ☐	Rushing ☐				LOA ☐	Product Improvement ☐				Substation ☐	Process Improvement ☐				Past Expiry Date ☐	Manufacturing Process ☐				Misidentified ☐	Past Due ☐			
Root Cause																																																																						
Environment ☐	No Re-verification ☐																																																																					
Design ☐	Operator ☐																																																																					
Doc/Data ☐	Offset/Setup ☐																																																																					
Equip/Tooling ☐	Supplier ☐																																																																					
Handling/Pre ☐	Training ☐																																																																					
Material ☐	Use for Testing ☐																																																																					
Internal Transport ☐	Poor Information ☐																																																																					
Tribal Knowledge ☐	Rushing ☐																																																																					
LOA ☐	Product Improvement ☐																																																																					
Substation ☐	Process Improvement ☐																																																																					
Past Expiry Date ☐	Manufacturing Process ☐																																																																					
Misidentified ☐	Past Due ☐																																																																					
<table style="width:100%; border: none;"> <tr> <td style="width:15%;">Ce.</td> <td style="width:15%;">Cracks</td> <td style="width:15%;">Crimp/Kink,</td> <td style="width:15%;">Cuffs</td> <td style="width:15%;">Crushing</td> <td style="width:15%;">Heat Treat</td> <td style="width:15%;">Wave/Twist in Tube</td> <td style="width:15%;">Marks/Chatter</td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </table>						Ce.	Cracks	Crimp/Kink,	Cuffs	Crushing	Heat Treat	Wave/Twist in Tube	Marks/Chatter																																																									
Ce.	Cracks	Crimp/Kink,	Cuffs	Crushing	Heat Treat	Wave/Twist in Tube	Marks/Chatter																																																															
<table style="width:100%; border: none;"> <tr> <td style="width:15%;">Power Loss/Surge</td> <td style="width:15%;">Folio/Program</td> <td style="width:15%;">Grain</td> <td style="width:15%;">Weld</td> <td style="width:15%;">Wrong Stock Pulled</td> <td style="width:15%;">Out of Sequence</td> <td style="width:15%;">Off-set</td> <td style="width:15%;">Mislabeled</td> <td style="width:15%;">Fit/Function</td> <td style="width:15%;">Misaligned/off center</td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </table>						Power Loss/Surge	Folio/Program	Grain	Weld	Wrong Stock Pulled	Out of Sequence	Off-set	Mislabeled	Fit/Function	Misaligned/off center																																																							
Power Loss/Surge	Folio/Program	Grain	Weld	Wrong Stock Pulled	Out of Sequence	Off-set	Mislabeled	Fit/Function	Misaligned/off center																																																													
<table style="width:100%; border: none;"> <tr> <td style="width:15%;">Positioned Wrong</td> <td style="width:15%;">Outside Dimensions</td> <td style="width:15%;">Over/Under tolerance</td> <td style="width:15%;">Part Incorrect</td> <td style="width:15%;">Part Lost/Missing</td> <td style="width:15%;">Part Moved</td> <td style="width:15%;">Drawing</td> <td style="width:15%;">Finish</td> <td style="width:15%;">Misread</td> <td style="width:15%;">Turning Sequence</td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> </tr> </table>						Positioned Wrong	Outside Dimensions	Over/Under tolerance	Part Incorrect	Part Lost/Missing	Part Moved	Drawing	Finish	Misread	Turning Sequence																																																							
Positioned Wrong	Outside Dimensions	Over/Under tolerance	Part Incorrect	Part Lost/Missing	Part Moved	Drawing	Finish	Misread	Turning Sequence																																																													
OTHER : _____																																																																						

UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG BEFORE PAINTING 4 -Paint Outside of Tube as per Dart QSI 005 4.2

210 - Then, Wrap in plastic bag to protect from scratches

220 - *****LAY DOWN CROSSTUBE ON TABLE AND PUT DT10302 PINS IN SADDLE HOLE FACING UP, USE HOLE IN TAPE MEASURE TO PUT IN PINS FOR LOCATING CENTER OF CROSSTUBE. ***** 1- Abrade mating surfaces of support and crosstube with 180 grit sandpaper, clean the area with MEK or equivalent as per dwg 2- Install supports with Proseal 890 per D212-664-141 and QSI 015 A/R Proseal 890 Batch: 138708 EXP: 5/18
PROSEAL CURE TIME 72 HOURS: Start: 17-12-23 Finish: 17-12-26 3- Install clamps with rubber cushion (ENSURE CLAMPS ARE INSTALL ON TOP SIDE OF CROSSTUBE) using DT9565 as per Dwg D212-664-141. ***Torque all clamps to 80-100 IN-LBS.***

230 - ***RE-CHECK TORQUE ON CLAMP AFTER PROSEAL HAS CURED FOR 72HOURS AS PER DWG.***

250 - ***VERIFY BY _____ BATCH # TO MATCH W/O _____

255 - Photocopy bluefile and create labels as per PPP D212-664-101 CHG006

260 - Identify and pack for shipping as per PPP D212-664-101 Location : FG094

Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation	D212-664-101TRN	1	1	0	0
240-Packaging	AN6-35A <u>5027265</u>	4 ✓	30	0	0
	AN6-36A <u>5027042</u>	4 ✓	20	0	0
	* D3428-1 <u>5027096</u>	1 ✓	19	0	0
	MS21042L6 <u>5027041</u>	6 ✓	234	0	0
	NAS1149D0663J <u>5027040</u>	8 ✓	666	0	0

220-

02893-1

5003772 (2)

M52190-25

M135948-1

(4)

D3595-063-450

5016774 (4)

Part Specifications

Specifications could not be found.

Plex 10/25/17 7:54 AM dart.Michaud-Febrille.Victoria

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

DART AEROSPACE LTD	Work Order:	167129-B
Description: Crosstube High Fwd (205/212/412)	Part Number:	D212-664-101
Inspection Dwg: D212-664-141	Rev: E	Page 1 of 1

Required Dimension	Min	Max
Height	26.67	27.17
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7
Bending Passes	3	--
Crushing	--	7.2%

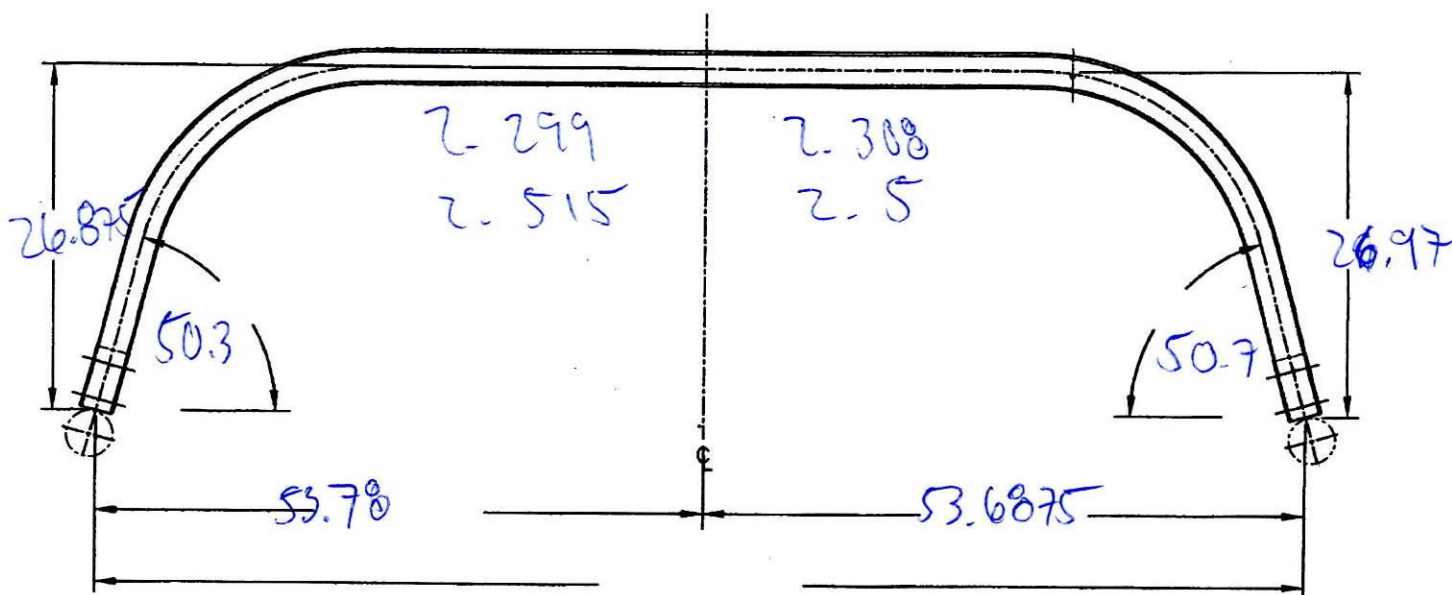

	Side A	Side B
Bending Passes	5	5
Crushing	4.4%	4%
Comments		

QC15 Inspection	DAS
Date	17.12.13

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	08.04.21	Dwg Rev updated	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	
E	14.07.28	Revised max crushing %	KJ	
F	16.01.15	Revised Height min/max dimensions	KJ	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐									
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval							
Description Work Order Deviation			Disposition								
			Completed By								
			Lead hand / Supervisor Approval Verification								
			QC / QA Coordinator Approval								
Root Cause		FAULT CATEGORY									
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐				Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	
OTHER : _____											

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-664-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-664-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3			X	D212-664-141F	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD) (ANODIZED)
4	1	1	1	D6005-128	CROSSTUBE
5	2		2	D2893-1	SUPPORT
6	4	4	4	D3595-063-450	RUBBER CUSHION
7		2		D5017-1	SUPPORT
8	4	4	4	MS21920-25	CLAMP (OR MS21920-26)
9	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 128.514±0.020
- 2) FINISH -141 & -141B: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
FINISH -141F: a) ANODIZE PER MIL-A-8625, TYPE II, CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT
***NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN NOT TO CONTAMINATE OR DAMAGE FINISHED SURFACES.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS
- 7) WEIGHT: D212-664-141/-141B/-141F = 33.6 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- 10) RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- 11) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 8% (BASED ON O.D.) ON REMAINING TUBE.
- 12) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY

- 13) TO INSTALL D2893-1 / D5017-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- 14) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 167129-B
WJH/1025

RELEASED
2014-05-26
WJH

E	ADD -141F, D5017-1 WAS D2893-1 (-141B), PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL, ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHAFING (B7-2, B7-3), BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-3), INCORP. DEO D-1/2/3	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS: ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C6-3, C8-3 & B6-3); RELOCATED FLAG #6 PER PAR 08-046 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -851 ABRASION STRIP; ADD MAGNOBOND 6398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED	DW		
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA

DRAWING NO. REV. E
D212-664-141 SHEET 1 OF 5
TITLE SCALE
XTUBE ASS'Y (205/212/412 HI FWD) NTS

COPYRIGHT © 2000 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

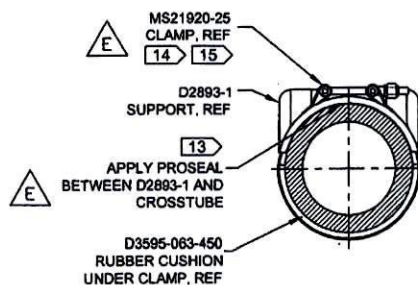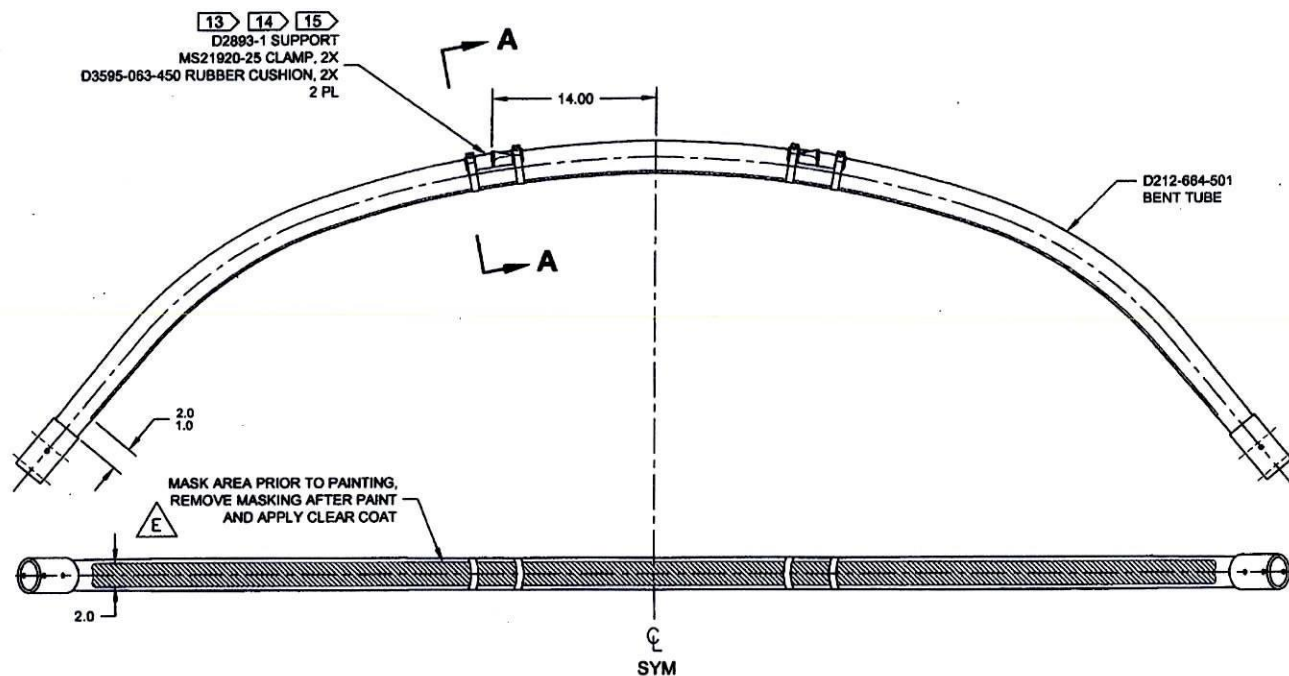

SECTION A-A
SCALE 4X

D212-664-141/-141F
ASSEMBLY DETAIL

RELEASED
2014-05-26
IND

DESIGN	Q	DART AEROSPACE LTD	
DRAWN	Q	HAWKESBURY, ONTARIO, CANADA	
CHECKED	W	DRAWING NO.	REV. E
MFG. APPR.	W	D212-664-141	SHEET 2 OF 5
APPROVED	W	TITLE	SCALE
DE APPR.	W	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

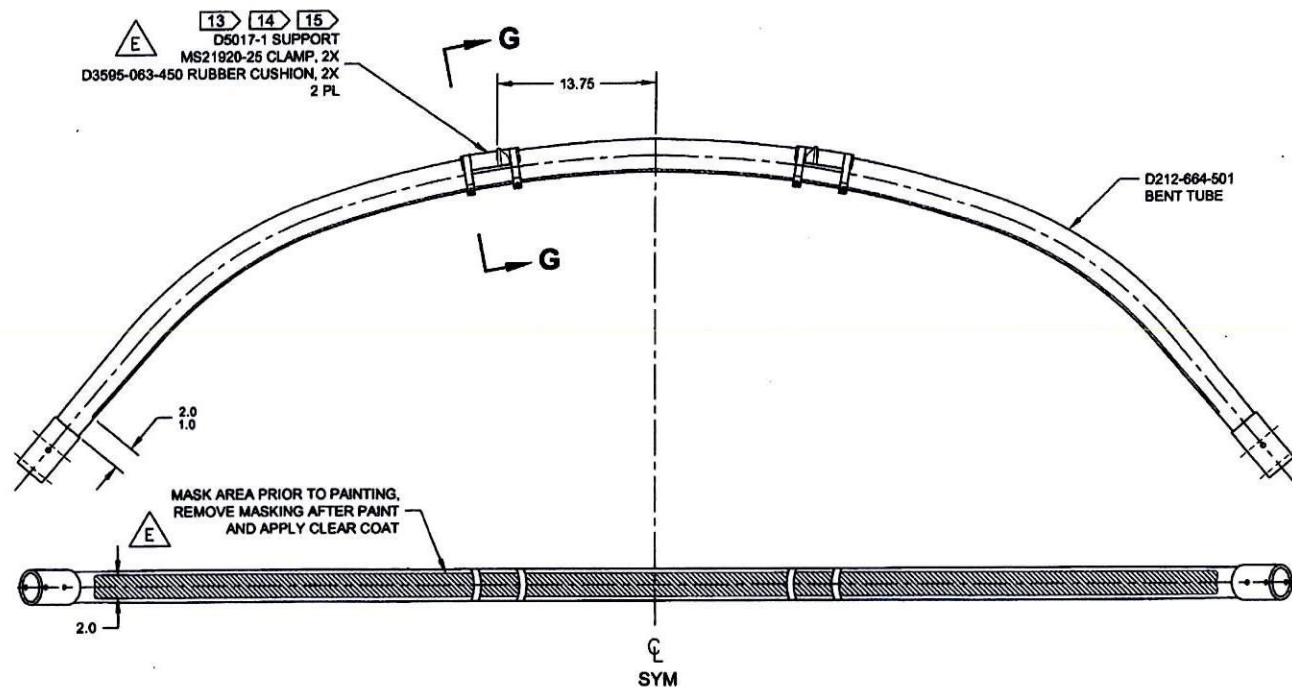

D212-664-141B
ASSEMBLY DETAIL

RELEASED
2014-05-26

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 3 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

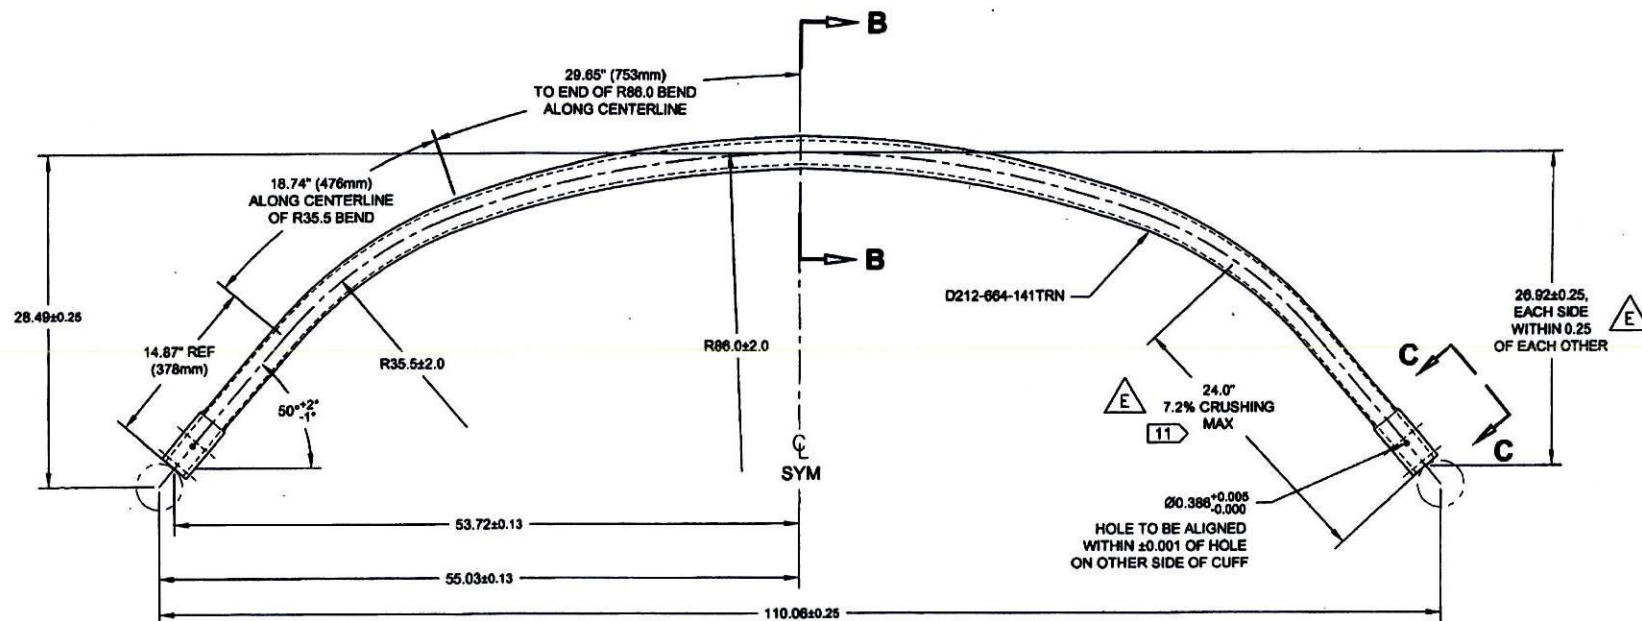

D212-664-501
BENDING AND DRILLING DETAIL

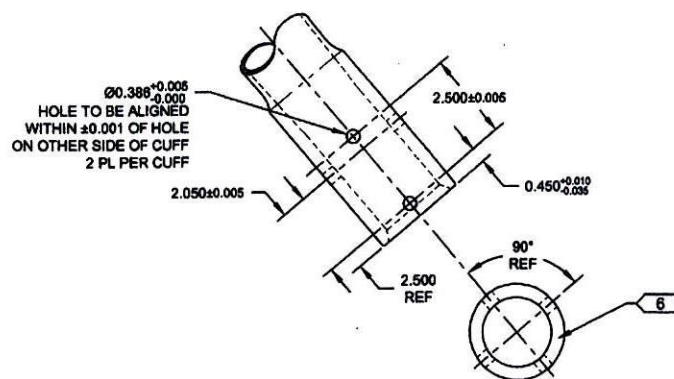

VIEW C-C: CUFF DETAIL
SCALE 3X

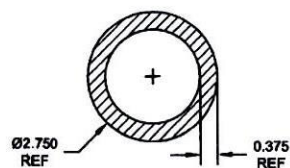

SECTION B-B
SCALE 4X

RELEASED
2014-05-26

DESIGN	92	DART AEROSPACE LTD	
DRAWN	92	HAWKESBURY, ONTARIO, CANADA	
CHECKED	92	DRAWING NO.	REV. E
MFG. APPR.	92	D212-664-141	SHEET 4 OF 5
APPROVED	92	TITLE	SCALE
DE APPR.	92	XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

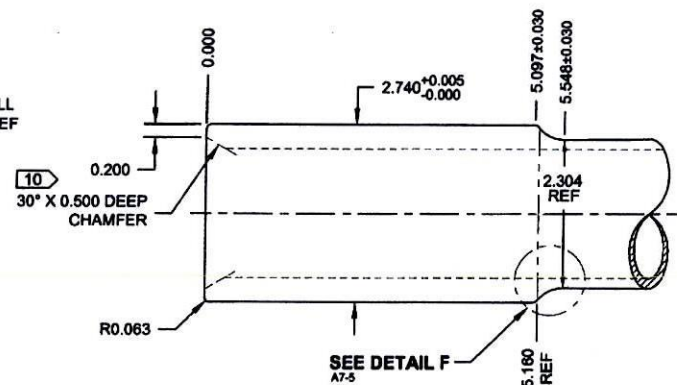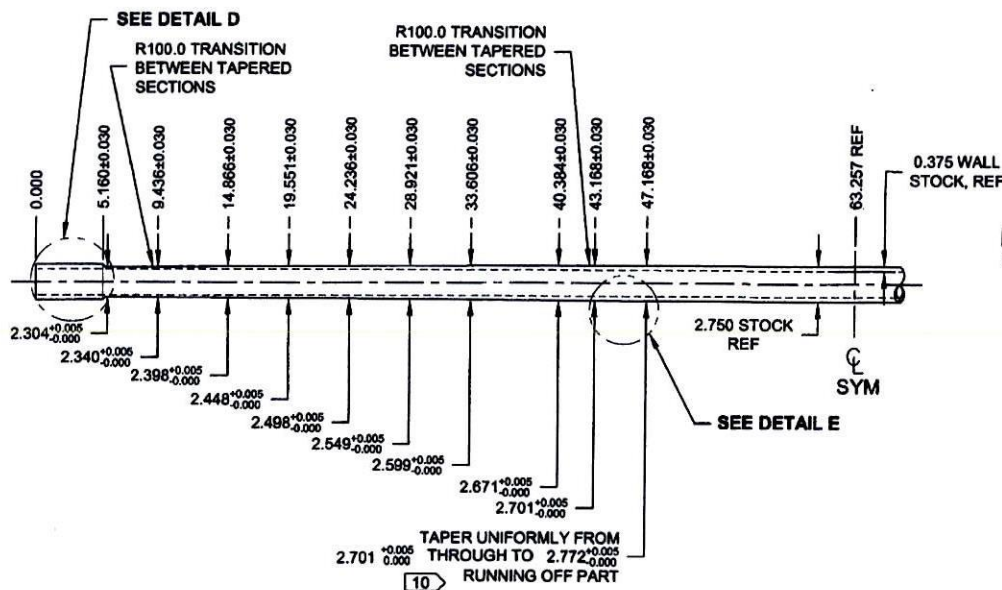


DETAIL D:
CROSSTUBE CUFF
SCALE 5X

D212-664-141TRN
TURNING DETAIL

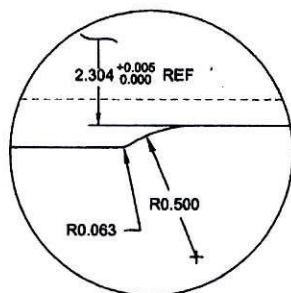

DETAIL F:
CUFF TRANSITION
SCALE 10X

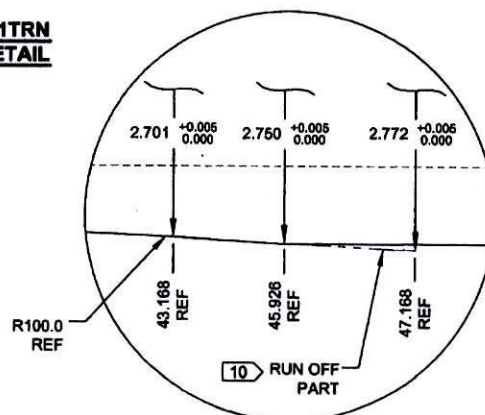

DETAIL E:
TAPER RUN-OFF
NOT TO SCALE

RELEASED
2014-05-26

DESIGN	92	DART AEROSPACE LTD	
DRAWN	92	HAWKESBURY, ONTARIO, CANADA	
CHECKED	SW	DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 5 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					

Root Cause				FAULT CATEGORY			
Environment ☐		No Re-verification ☐		Pressure/Forced ☐		Temperature/Cure ☐	
Design ☐		Operator ☐		Bending ☐		Set-up ☐	
Doc/Data ☐		Offset/Setup ☐		Centre Not Concentric ☐		BOM/Route ☐	
Equip/Tooling ☐		Supplier ☐		Cracks ☐		Broken/Damage/Defect ☐	
Handling/Pre ☐		Training ☐		Crimp/Kink/Ripple/Wave ☐		Inspection Incomplete/Unqualified ☐	
Material ☐		Use for Testing ☐		Cuffs ☐		Contamination ☐	
Internal Transport ☐		Poor Information ☐		Crushing ☐		Countersink ☐	
Tribal Knowledge ☐		Rushing ☐		Heat Treat ☐		Cut Too Short ☐	
LOA ☐		Product Improvement ☐		Wave/Twist in Tube ☐		Instructions Incomplete/Unclear ☐	
Substation ☐		Process Improvement ☐		Marks/Chatter ☐		Drill Holes ☐	
Past Expiry Date ☐		Manufacturing Process ☐		OTHER : _____			
Misidentified ☐		Past Due ☐					

**skyservice****Work Order Traveler**
Sky Service F.B.O. Inc.

10105 Ryan Avenue, Dorval, Quebec, H9P 1A2

TCCA AMO 53-89 / EASA 145.7142 / BDA AMO 385


WO #: MWO34413	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: PO038694
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT ON 4 CROSSTUBES , P/N# D212-664-101 , J/S# 167129 , 167129-A ,
167129-B , 167129-C AS PER PO038694

Action Taken:						Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417M-13 NO CRACK FOUND PEN. ZL-56, MPO13600, CLEANER SKC-S MPO13923 , DEV. MPO11715 , UV LIGHT M-20142						DEC 20 2017	 
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

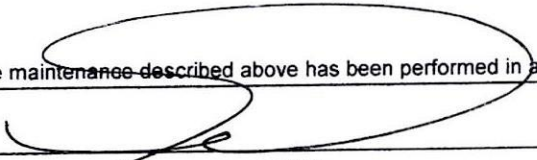Signature: 	ACA/SCA Stamp 	Date: DEC 20 2017
Name: RAFIK MELIKIAN		

PAGE 1 OF 1

Description: CROSSTUBE INSTALLATION, HIGH FWD

[illegible]